


Non-indicating Pressure Transmitters

■ Features

- Excellent corrosion resistance with stainless steel housing
- High accuracy $\pm 0.3\%$ F.S.
- Various connection method
 - Head type, DIN connector type, connector cable type
- Various user friendly function
 - Built-in zero-point, span adjustment (head type)

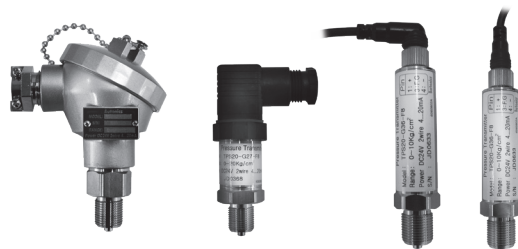

[Head type] [DIN connector type] [Connector cable type]

⚠ Please read "Safety Considerations" in the instruction manual before using.



■ Ordering Information

TPS20 – G 1 5 F8 (0 to 5kgf/cm²)

① ② ③ ④ ⑤ ⑥

Non-indicating Pressure Transmitters	
① Item	TPS20 Pressure Transmitter
② Measurement pressure	G Gauge pressure A Absolute pressure
③ Cable	1 Head type 2 DIN connector type 3 Connector cable type
④ Pressure range	Gauge pressure
	Absolute pressure
	1 0 to 0.2kgf/cm ² —
	2 0 to 0.5kgf/cm ² —
	3 0 to 1kgf/cm ² 0 to 1kgf/cm ²
	4 0 to 2kgf/cm ² 0 to 2kgf/cm ²
	5 0 to 7kgf/cm ² 0 to 7kgf/cm ²
	6 0 to 10kgf/cm ² 0 to 10kgf/cm ²
	7 0 to 20kgf/cm ² 0 to 20kgf/cm ²
	8 0 to 35kgf/cm ² 0 to 35kgf/cm ²
	9 0 to 70kgf/cm ² —
	A 0 to 100kgf/cm ² —
	C 0 to 200kgf/cm ² —
	F 0 to 300kgf/cm ² —
	H 0 to 350kgf/cm ² —
	M -760mmHg to 0kgf/cm ² —
	O -760mmHg to 1kgf/cm ² —
	Q -760mmHg to 7kgf/cm ² —
	V -760mmHg to 10kgf/cm ² —
	X -760mmHg to 20kgf/cm ² —
	Y -760mmHg to 35kgf/cm ² —
	Z Others
⑤ Pressure port	P2 R1/2 (with adapter, PT)
	P8 R3/8 (with adapter, PT)
	F8 G3/8 (standard, PF)
	ZZ Others
⑥ User pressure range	User pressure range ^{*1}

※ 1: Write the desired pressure range and it is the default of user pressure range. (select "Z" at ④Pressure range)

※ For ordering cable, order as CID3-2, CID3-5, CLD3-2, CLD3-5. (sold separately)

■ Specifications


Series	TPS20		
Pressure type	Gauge pressure	Absolute pressure	Compound pressure
Rated pressure range	0 to 0.2 to 350kgf/cm ²	0 to 1.0 to 35kgf/cm ²	-760mmHg to 0 to 35kgf/cm ²
Max. pressure range	300% of max. span		
Measured materials	Liquid, gas, oil (except corrosive environment of stainless steel type 316)		
Power supply	15-35VDC==		
Permissible voltage range	90 to 110% of rated voltage		
Current consumption	Max. 50mA		
Response time	Max. 100ms		
Protection circuit	Reverse polarity protection circuit		
Current output	DC4-20mA		
Linearity	±0.3% F.S. (-10 to 50°C), ±0.5% F.S. (50 to 70°C)		
Hysteresis	±0.3% F.S.		
Temp. Zero Shift	±0.03% F.S.		
Temp. Span Shift	±0.03% F.S. (at 25°C)		
Load resistance	Max. 600Ω		
Insulation resistance	Over 100MΩ (at 500VDC megger)		
Dielectric strength	500VAC 50/60Hz for 1 minute		
Vibration	1.5mm amplitude at frequency of 10 to 55Hz (for 1 min) in each X, Y, Z direction for 2 hours		
Shock	95m/s ²		
Tightening torque	Industrial plug over 5N		
Pressure port	G3/8t (standard), R3/8, R1/2		
Environ- ment	Ambient temp.	-10 to 70°C, storage: -10 to 70°C	
	Ambient humi.	5 to 95% RH, storage: 5 to 95% RH	
Materials	Sealing, diaphragm, connection: stainless steel type 316, O-ring: fluoro rubber		
Connection	+, -		
Case structure	Drip-proof structure		
Approval	CE		
Weight ^{※1}	Approx. 350g (approx. 320g) (based on head type)		

※ 1: The weight includes packaging. The weight in parenthesis is for unit only.

※ F.S.(Full Scale): It is rated pressure range.

※ Environment resistance is rated at no freezing or condensation.


■ Example of External Connections

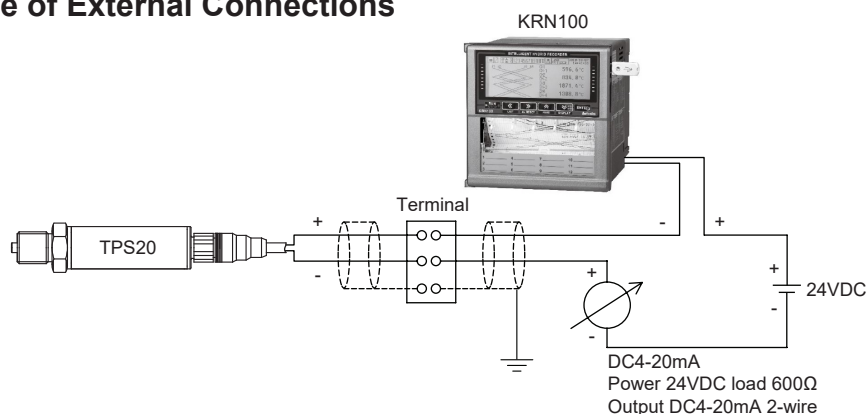


■ Dimensions

(unit: mm)


• Head type

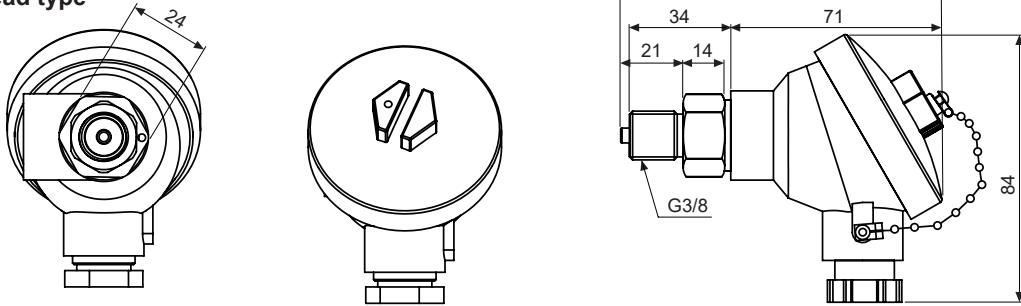

• DIN connector type

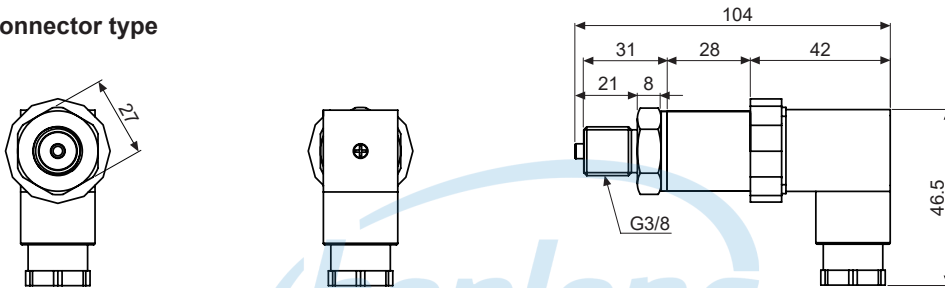

• Connector cable type

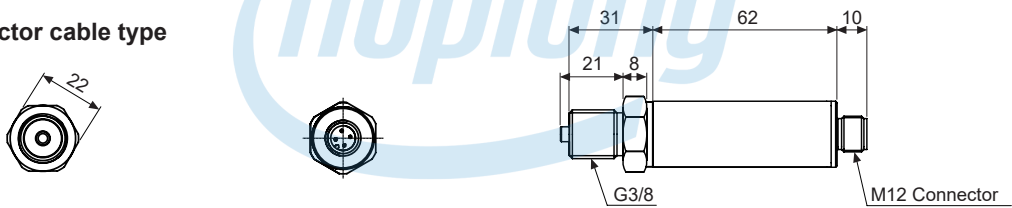


※The standard pressure port for above is G3/8.

■ Connection Cable (Sold Separately)


• CID3-2 / CID3-5

(unit: mm)

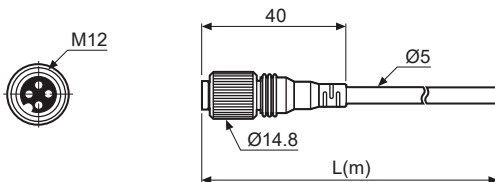




Model	L (m)	Material
CID3-2	2	PVC
CID3-5	5	

• CLD3-2 / CLD3-5

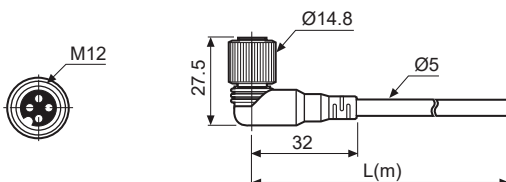

Model	L (m)	Material
CLD3-2	2	PVC
CLD3-5	5	


■ Connectors

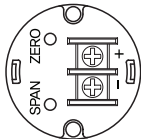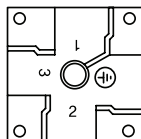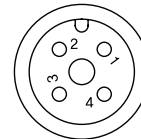Head type		DIN connector type			Connector cable type		
	Pin		Pin	Func.		Pin	Func.
	+		1	+		1	+
	-		2	-		2	N-C
			3	N-C		3	F.G.
			⊕	F.G.		4	-

※ In case of head type, remove the top cover.



■ Connections

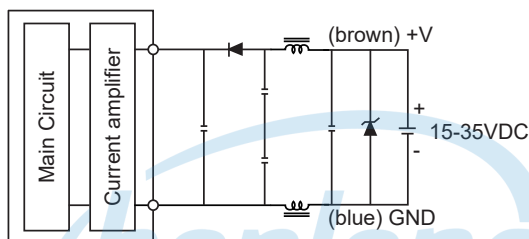

■ Troubleshooting

Error	Troubleshooting
No outputs	Check the power supply. Check the polarity (+, -) when wiring cable. Check the connection part.
Abnormally fluctuating output	Check the power supply. Check the supplied pressure. Check the pressure line.
Out of zero point output value	Check the power supply. Check the load resistive value of current output type for a receiver is over 600Ω. Check the measuring point and transmission distance. Check the line resistance is below 600Ω.

■ Proper Usage

- Follow instructions in 'Cautions during Use'. Otherwise, It may cause unexpected accidents.
- 15-35VDC power supply should be insulated and limited voltage/current or Class 2, SELV power supply device.
- When installing the unit on pipe line, use the hexagon part of connections not to turn the unit with a pipe wrench. Do not use the unit with strong vibrations.
- Store the unit at the place without moisture, dust, and vibration.
- This product which does not have drive part at sensing part does not need to repair it. Even though inside of pressure pipe is normally clean, it needs to take maintenance once a year as below instructions.
 - Check the broken status of outside.
 - Check the pressure slot, cleanliness inside, and corrosion state.
 - Short each terminal and check the insulation resistance between the case and power.
- When removing a sensor for maintenance, follow the below instructions.
 - Replace an O-ring which is used once.
 - Be sure that diaphragm part is not damaged.
- Switch or circuit breaker for supplying or cutting off the power should be installed nearby users for convenient control.
- The unit cannot be repaired due to disassembled structure.
- The unit is fixed with bolt and nut at the both sides of case.
Do not press excessive load (approx. 300kg/cm²), or it may cause damage to the unit.
- This unit may be used in the following environments.
 - Indoor / Outdoor (in the environment condition rated in 'Specifications')
 - Altitude max. 2,000 m
 - Pollution Degree 2
 - Installation Category II